

SPX Corporation  
5885 11th Street  
Rockford, IL 61109-3699 USA

Internet Address:  
<http://www.powerteam.com>  
Tech. Services: (800) 477-8326  
Fax: (800) 765-8326  
Order Entry: (800) 541-1418  
Fax: (800) 288-7031


SPX Corporation  
655 Eisenhower Drive  
Owatonna, MN 55060-0995 USA  
Phone: (507) 455-7000  
Tech. Services: (800) 533-6127  
Fax: (800) 955-8329  
Order Entry: (507) 455-1480  
Fax: (800) 283-8665  
International Sales: (507) 455-7223  
Fax: (507) 455-7746

## Parts List for:

52351  
RD8013

## DOUBLE-ACTING HYDRAULIC CYLINDER

Max. Capacity: 80 Tons at 10,060 PSI

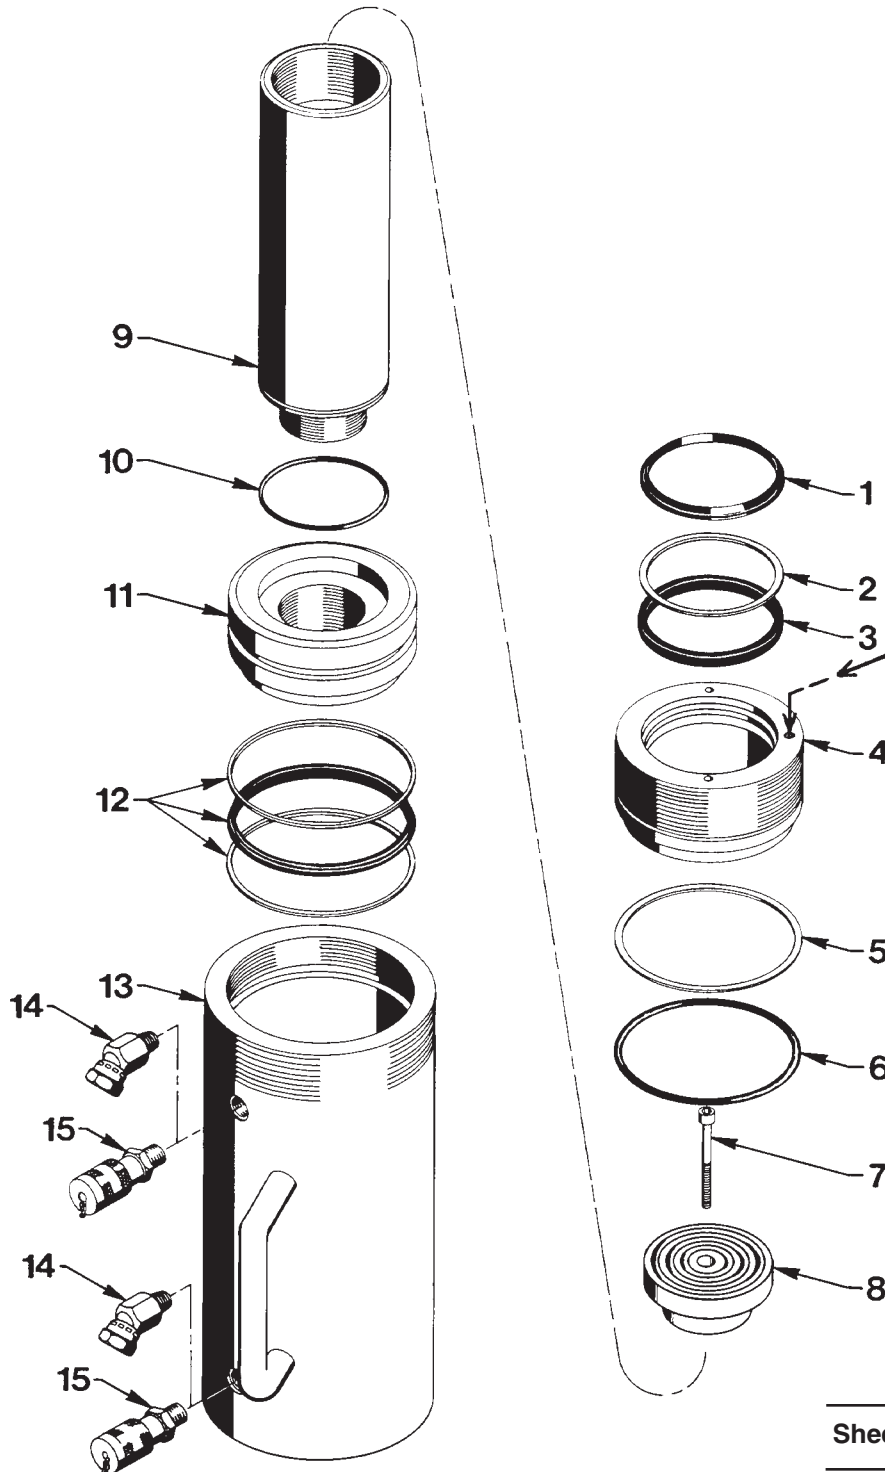

### Double-acting Cylinder Relief Valve

See important

**! DANGER**  
statement  
on back of  
sheet 1 of 1

Sheet No. 1 of 1

Rev. Date: 25 Jan. 1995



**DANGER:** To help avoid possible serious personal injury or death,

- In the event that the cylinder retract port is ever restricted or plugged, a double-acting cylinder relief valve will help prevent excessive pressure from building in the cylinder. **DO NOT** attempt to adjust or service this relief valve! If oil leakage is detected from this relief valve, discontinue use of the cylinder immediately and contact Power Team or OTC Technical Services. Only Power Team or OTC Authorized Hydraulic Service Centers should service this relief valve.

| Item No. | Part No. | No. Req'd | Description                                                              |
|----------|----------|-----------|--------------------------------------------------------------------------|
| 1        | *19314   | 1         | Rod Wiper                                                                |
| 2        | *19154   | 1         | Backup Washer (3 3/8 X 3" X .070, -337)                                  |
| 3        | *12700   | 1         | U-cup                                                                    |
| 4        | 52353    | 1         | Retainer Nut (Torque to 150 ft. lbs. min.)                               |
| 5        | *210402  | 1         | Backup Washer (4-1/16 X 4-3/8 X .048, -245)                              |
| 6        | *210403  | 1         | O-ring (4-1/16 X 4-3/8 X 1/8, -245)                                      |
| 7        | 10435    | 1         | Socket Head Cap Screw (3/8-16 X 2-1/2 Lg.)                               |
| 8        | 305070   | 1         | Serrated Insert                                                          |
| 9        | 45723    | 1         | Piston Rod                                                               |
| 10       | *210404  | 1         | O-ring (3" X 2-3/4 X 1/8, -232)                                          |
| 11       | 45724    | 1         | Piston Head (Torque to 200 ft. lbs. min.)                                |
| 12       | *210405  | 1         | T-Seal & Backup Rings (Smooth side of Backup Ring must be against seal.) |
| 13       | 51268    | 1         | Cylinder Body                                                            |
| 14       | 10648    | 2         | 45° Elbow Fitting (For 52351)                                            |
| 15       | 9796     | 2         | Quick Coupler Ram Half w/Dust Cap (For RD8013)                           |

**PARTS INCLUDED BUT NOT SHOWN**

|        |   |                               |
|--------|---|-------------------------------|
| *37782 | 1 | Warning Decal                 |
| 210406 | 1 | Trade Name Decal (For RD8013) |

Part numbers marked with an asterisk (\*) are contained in Repair Kit No. 300410.

Note: Shaded areas reflect last revision(s) made to this form.

Refer to any operating instructions included with this product for detailed information about operation, testing, disassembly, reassembly, and preventive maintenance.

Items found in this parts list have been carefully tested and selected. **Therefore: Use only genuine replacement parts!**

Additional questions can be directed to our Technical Services Department.