

SPX**POWER TEAM®**

SPX Corporation
5885 11th Street
Rockford, IL 61109-3699 USA

Tech. Services: (800) 477-8326
Fax: (800) 765-8326
Order Entry: (800) 541-1418
Fax: (800) 288-7031

Internet Address:
<http://www.powerteam.com>


Parts List for:

Form No. 101736

C106CBT
C1010CBT
C1010CBT-PFAFF

Model B
SINGLE-ACTING, SPRING RETURN
HYDRAULIC CYLINDER
Max. Capacity: 11.2 Tons at 10,000 PSI

To Parts
List

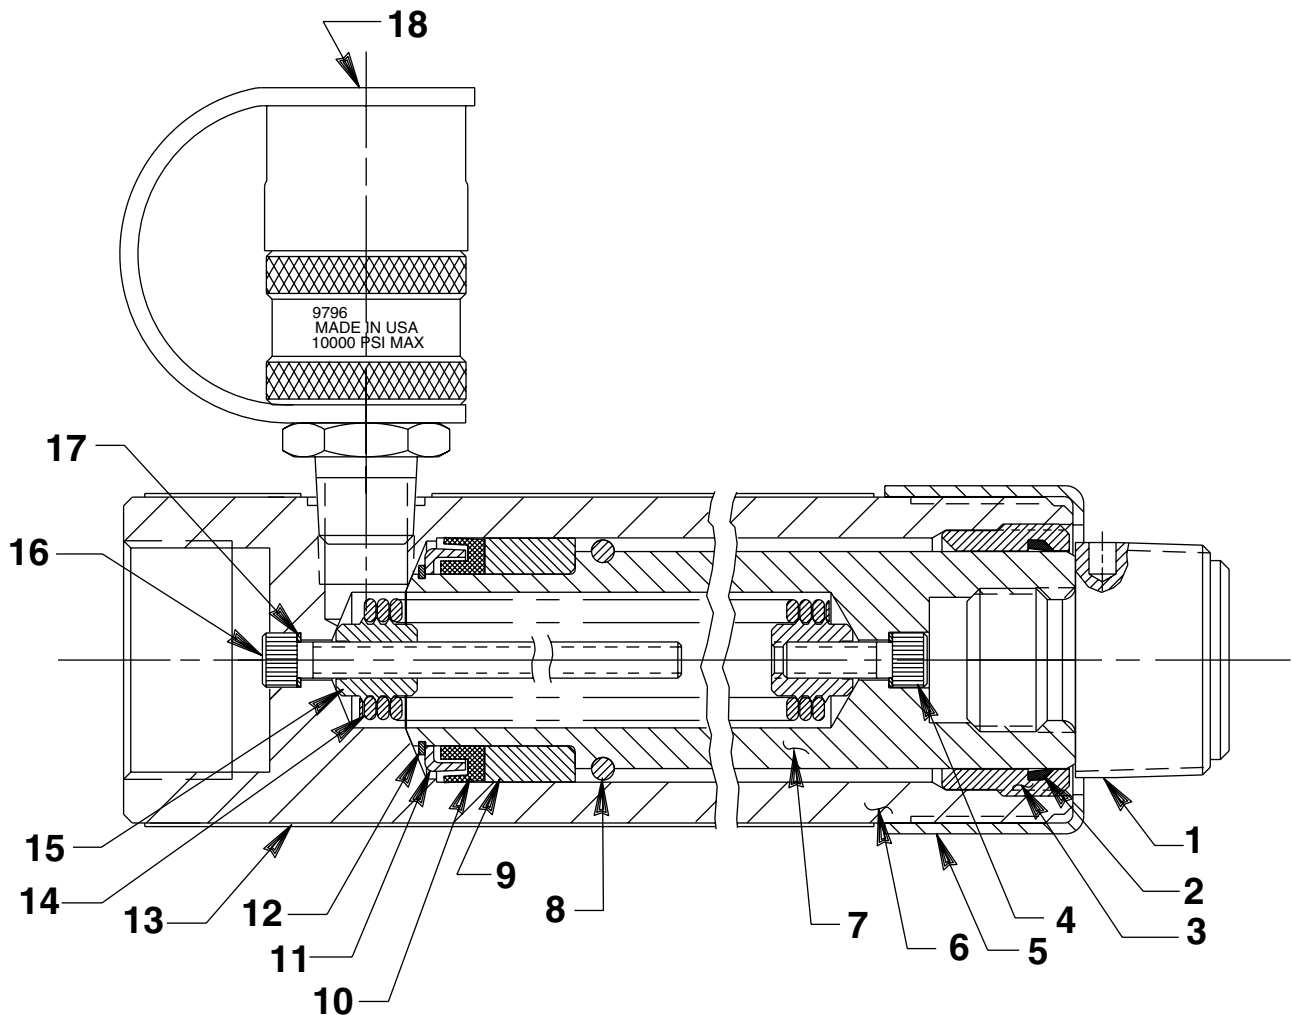

Refer to any operating instructions included with this product for detailed information about operation, testing, disassembly, reassembly, and preventive maintenance.

Items found in this parts list have been carefully tested and selected. **Therefore: Use only genuine Power Team replacement parts!**

Additional questions can be directed to our Technical Services Department.

Note: Shaded areas reflect last revision(s) made to this form.

Sheet No. 1 of 1

Rev. 1 Date: 7 May 1997

Item No.	Part No.	No. Req'd	Description
1	202179	1	Thread Adapter (Torque to 100 ft. lbs.)
2	†*201429	1	Rod Wiper
3	351051	1	Retainer Nut (Torque to 90/100 in. lbs.)
4	10006	1	Soc. Hd. Cap Screw (1/4-20 X 5/8 Lg.; Torque to 90/110 in. lbs.)
5	36146	1	Thread Protector - Plastic
6	42447	1	Cylinder Body (For C106CBT)
	42448	1	Cylinder Body (For C1010CBT)
7	421003	1	Piston Rod (For C106CBT)
	421073	1	Piston Rod (For C1010CBT)
8	201433	1	Retaining Ring
9	201364	1	Piston Head (Assemble with groove towards shoulder)
10	*16067	1	U-cup Piston Seal
	†205704	1	U-cup
11	201359	1	Slip Retainer
12	*16076	1	Retaining Ring
13	421386	1	Full Coverage Decal (For C106CBT)
	421387	1	Full Coverage Decal (For C1010CBT)
	252183	1	Trade Name Decal (For C1010CBT-PFAFF)
14	201431	1	Extension Spring (For C106CBT)
	201432	1	Extension Spring (For C1010CBT)
15	201360	2	Spring Retainer
16	16064	1	Soc. Hd. Cap Screw (1/4-20 X 3-1/2 Lg.; Torque to 90/110 in. lbs.)
17	†*10442	2	Copper Washer
18	9796	1	Ram Half Coupler with Dust Cap

PARTS INCLUDED BUT NOT SHOWN


*203908	1	Warning Decal (For C106CBT & C1010CBT)
203908-CE	1	Warning Decal (For C1010CBT-PFAFF)
†206554	1	U-cup Backup Washer
†19526	1	O-ring (For coupler)
†205724	1	Decal (Viton)



Part numbers marked with an asterisk (*) are contained in Standard Repair Kit No. 300116.

Part numbers marked with a dagger (†) are contained in Viton Seal Kit No. 300211.

SPRING & RETAINER ASSEMBLY

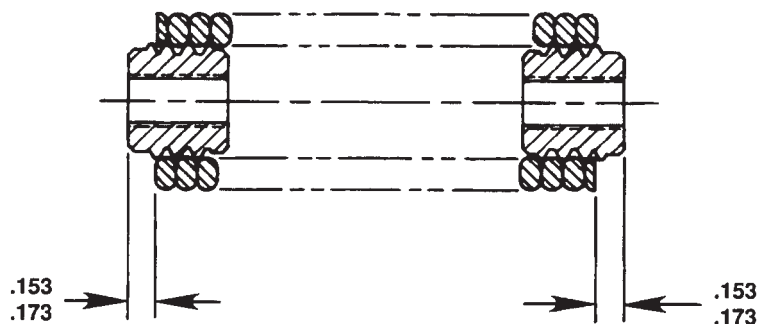

Spring must not extend beyond threads of spring retainer on either end. Stretch, clean and lubricate before assembly.

Note: Shaded areas reflect last revision(s) made to this form.